



CANADA

PLEASE QUOTE
FILE NO. 0/3 251

ADDRESS REPLY TO
COMMISSIONER OF YUKON TERRITORY

DEPARTMENT
OF

NORTHERN AFFAIRS AND NATIONAL RESOURCES

SECURITY PUBLIC BY AL. W. FARMER Y.T. 0 - 2

Rig No.: Parker Drilling Co. Rig # 10
Area: Eagle Plains, Yukon
Date Visited: March 3, 1965
Work going on: Drilling at approx. 1,190'
Tool Push: Ron Purcell
General:
 Housekeeping: Fair but rig floors cluttered with old rags, ropes and pieces of boards.
 Blowout preventers: Checked. O.K. Flare line not stacked down.
Protective Equipment: Men wearing hard hats and safety boots.

(2) Boilers - Condition & Equipment: Satisfactory. Inspected November 1964 - Alberta.

Mud System: Satisfactory.


Engines & Fuel: Satisfactory. Guards of water-pump belt and / 2 pump clutch.

Steps, Rig Floor & Draw Works: Stairs on left side of rig have only one guard rail and it is loose. Stairs from doghouse has loose guard rails. Stairs from rig floor to pipe ramp did not have satisfactory guard rail and upper step needed repair.

Rotary Tonges, Counter-balances & Safety Lines: Satisfactory

Drill Line & Dead End: Satisfactory

Mud Hose, Cathead & Spinning Line or Chain: Satisfactory

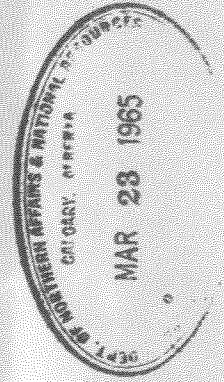

Elevators, Pins and Bails:

Satisfactory

Hand Tools:

Satisfactory

Derrick & Derrick Equipment:

Satisfactory

Derick Man's Line, Belt
& Safety:

Satisfactory

Observations:

Sub rack loose and pins bent

Breathing apparatus 3 Scott and 2 Curdians - O.K.

No Rig Record Book (See Sec. 51 of Regulations)

Recommendations:

1. Repair and tighten the guard rails and steps on the stairways from the rig floor and dog house. (See Section 57 of Regulations).
2. Secure the sub rack to the floor and straighten the pins. Place the pins over the pins - not between them.
3. Replace the guards on the water pump belt and on the # 2 pump clutch.
4. Clean up the old rags, boards and other material cluttering up the rig floor.
5. Stake down flare line.
6. Entries prescribed in Sec. 51 of Regulations may be entered in Daily Drilling Record Book.

Please advise this office in writing within 30 days what action has been taken towards the above recommendations.

WFO at Midvale, Utah

Yours truly,

March 6, 1955.

R. S. Keulhan

for A. D. Oliver,
Resident Mining Inspector.